



P/N: 60-03-1M20-009 (REV. B)

Description: SMA Straight Male Crimp for LMR300 Cable

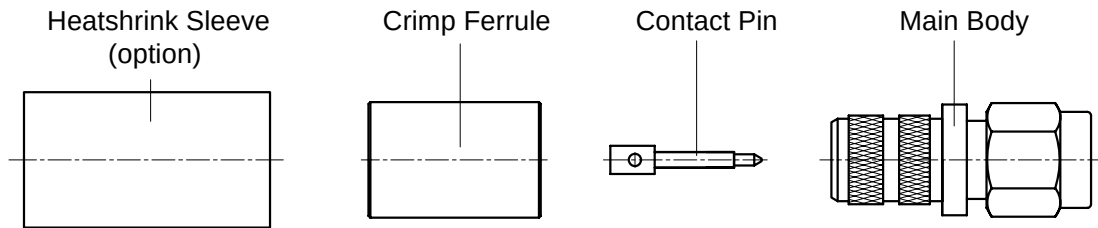


STEP 1

- Slide the Heatshrink Sleeve onto the cable (option).
- Slide the Crimp Ferrule onto the cable.
- Strip the cable according to the dimensions as below.

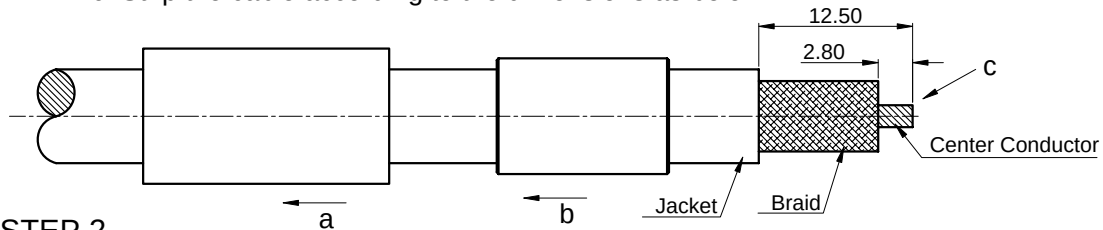


STEP 2

- Slide the Contact Pin on until it bottom against the cable dielectric..
- Solder the Contact Pin onto the cable.

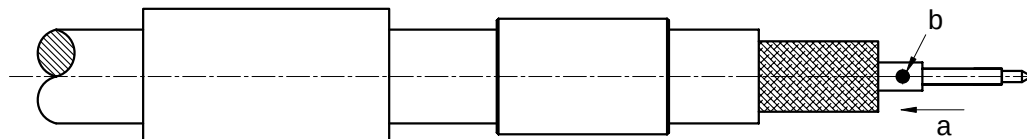


STEP 3

- Fan the braid.
- Slide the cable into the Main Body until it stops.

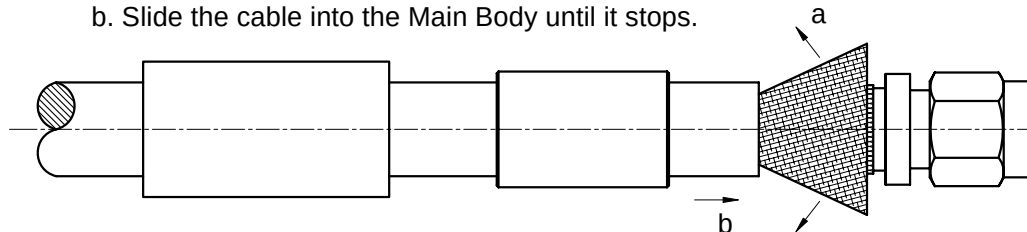


STEP 4

- Slide the Crimp Ferrule over the braid.
- Crimp the Crimp Ferrule with crimping tool (8.2mm HEX.).

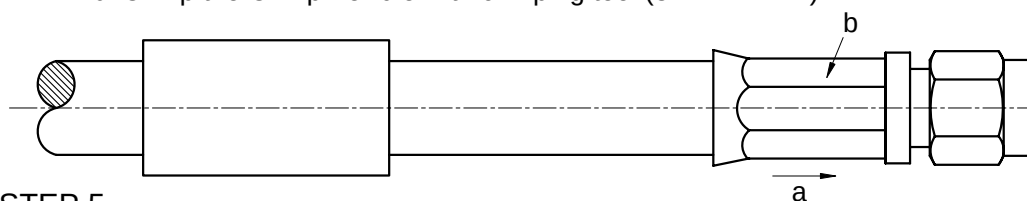

STEP 5

- Cut the excess of braid if necessary.
- Slide the Heatshrink Sleeve over the Crimp Ferrule and heatshrink it in place (option).

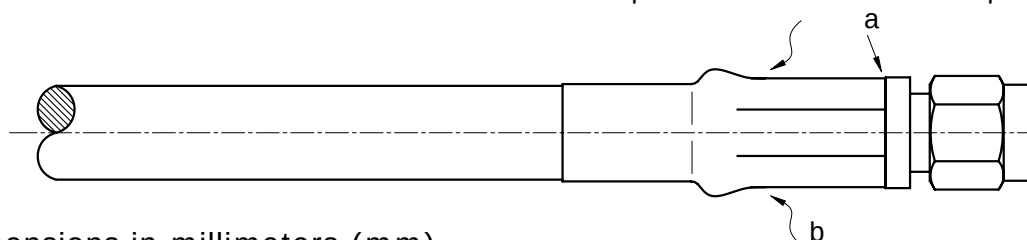

Note: Dimensions in millimeters (mm).