
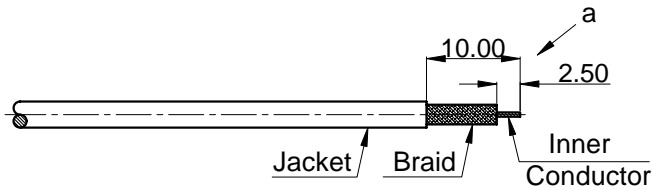



P/N: 10-03-4M00-011 (REV. B)

Description: BNC Straight Male Clamp for LMR100/RG174/RG316 Cable

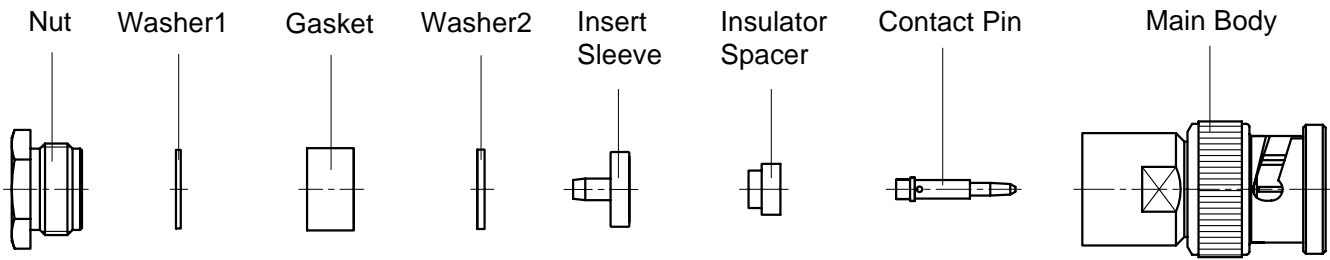


STEP 1

- Strip the cable according to the dimensions as shown.

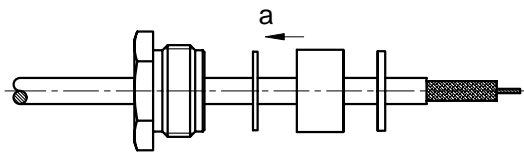


STEP 2

- Slide the Fastening Nut, Washer1 (thinner), Gasket, Washer2 (thicker) onto the cable in order as show.

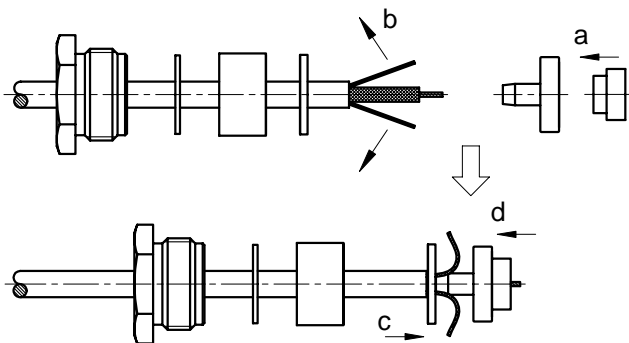


STEP 3

- Slide the Insulator Spacer into the Insert Sleeve.
- Fan the braid.
- Move the Washer2 (thicker) onto the cable's braid.
- Push the Insert Sleeve into the cable's braid.

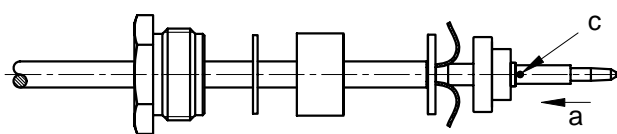


STEP 4

- Slide the Contact Pin onto the cable's center conductor until it stops.
- Solder the Contact Pin onto the cable.

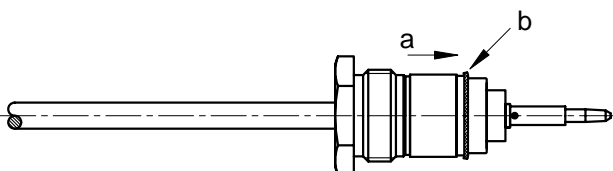

STEP 5

- Slide the Gasket, Washer1 (thinner) and Fastening Nut until they stops (keep the Insert Sleeve still).
- Cut the excess of braid.

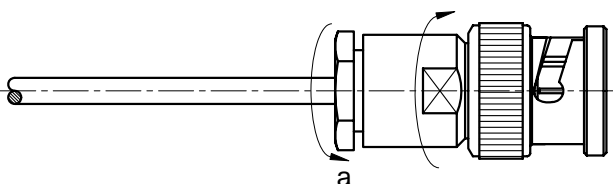

STEP 6

- Screw the Fastening Nut into the Main Body with wrench.