



P/N: 61-13-1M18-011 (REV. A)

Description: RP SMA Right Angle Male Crimp for LMR195/RG58 Cable

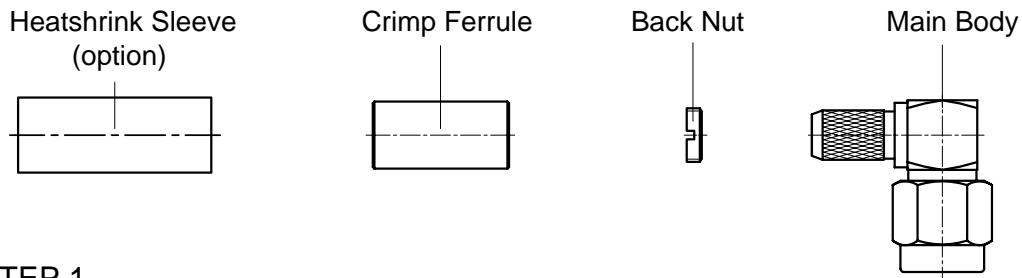


**STEP 1**

- a. Slide the Heatshrink Sleeve onto the cable (option).
- b. Slide the Crimp Ferrule onto the cable.
- c. Strip the cable according to the dimensions as below.  
Attention: The LMR195 Cable must remove the aluminum tape.

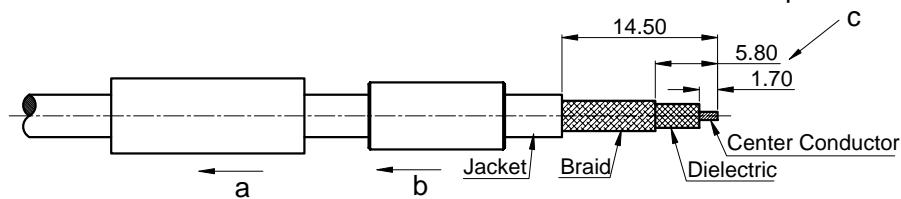


**STEP 2**

- a. Fan the braid.
- b. Slide the cable into the Main Body.

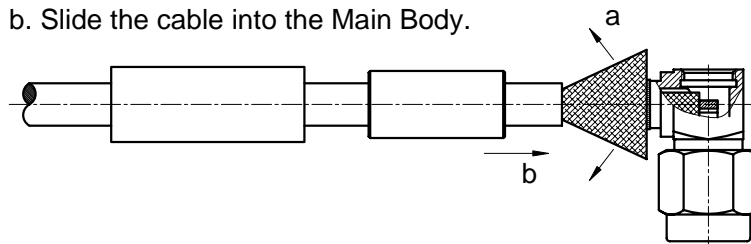


**STEP 3**

- a. Slide the Crimp Ferrule over the braid.
- b. Crimp the Crimp Ferrule with crimping tool (5.4mm HEX.).
- c. Solder the cable's inner conductor.

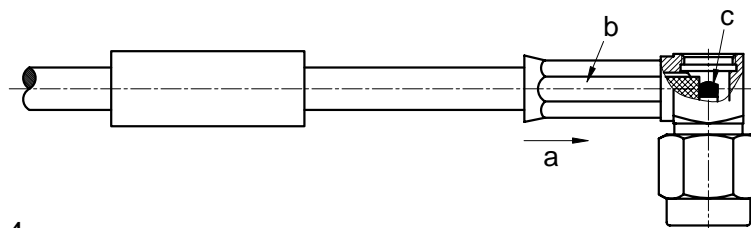

**STEP 4**

- a. Screw the Back Nut onto the Main Body.
- b. Cut the excess of braid if necessary.
- c. Slide the Heatshrink Sleeve over the Crimp Ferrule and heatshrink it in place (option).

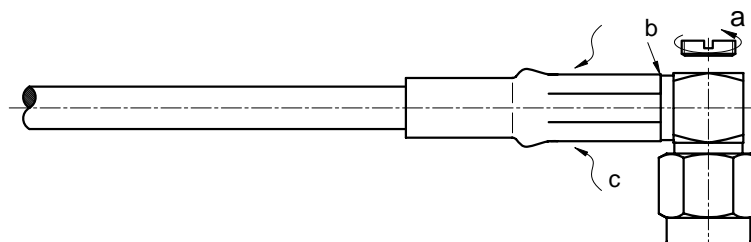

Note: Dimensions in millimeters (mm).